


FORD Focus: 1GJH088

Vinnumber:	WF0LXXGCBLEY82301	Versionname:	FOCUS CLIP. ECONetic Trend 88g 105PK
First Registrationdate:	24/02/2014	Fiscalpower:	
Expertise Mileage:	114972	Power Kw:	77
Bodytype:	Break	Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3327
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
GPS storage		Rear parking sensors	
GPS storage	SD	Type of Tow bar	Tow bar fixed
Windows electric F			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	205/55/16/91 T Steel			
Winter tyres:	Fr.L.	Pirelli: 5 mm	Fr.R.	Pirelli: 5 mm
	Re.L.	Kleber: 6 mm	Re.R.	Kleber: 6 mm

Assistance equipment

Spare tyre compact	Yes	Jack	Yes
--------------------	------------	------	------------

Total cost ex VAT	1081,96
Rear window, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Wing R R, Scratch(es), LI - Repair and paint (complete)	308,20




Bumper corner R L, Scratch(es), It - Spot repair	115,56
--	---------------



Interior, Stain, Cleaning 50,00



Bumper R, Scratch(es), E - Replace 415,20

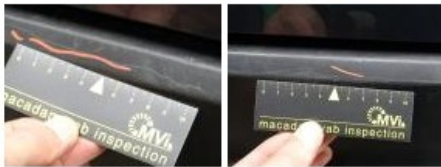

Wheel cover F R, Scratch(es), E - Replace 30,00



Trunk lid covering R, Scratch(es), E - Replace 133,00



Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Bump(s), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Centre console, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R R, Scratch(es), E - Replace 30,00



Wing R L, Scratch(es), Acceptable

0,00

No pictures to display