



OPEL Insignia: 1GJJ305

Vinnumber:	WOLGM8ES2E1075035	Versionname:	INSIGNIA BRE ecoFL.Business 140PK
First Registrationdate:	24/02/2014	Fiscalpower:	
Expertise Mileage:	129972	Power Kw:	103
Bodytype:	Break	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1714
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	Front parking sensors
Steering wheel multifunction	Rear parking sensors
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining fabrics
Type of climate control:	Autom climate control

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	215/60/16/99 H LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 5 mm	Fr.R.	Uniroyal: 5 mm
	Re.L.	Uniroyal: 5 mm	Re.R.	Uniroyal: 5 mm

Assistance equipment


Spare tyre compact	Yes	Jack	Yes
--------------------	------------	------	------------

Total cost ex VAT	1035,41
-------------------	----------------

Door R R, Scratch(es), LI - Repair and paint (complete)	318,35
---	---------------



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	--------------

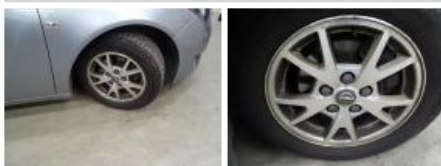



Roof, Scratch(es), LI - Repair and paint (complete)	481,50
---	---------------



Rearview mirror housing R, Damaged, LI - Repair and paint (complete)	115,56
--	--------



Bonnet, Bad repair, Paint	0,00
---------------------------	------

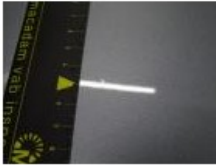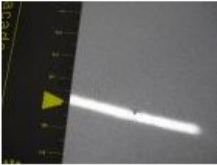

Tyre F L, Flat, I - Repair	25,00
----------------------------	-------



Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Alloy rim F L, Rust, Acceptable	0,00
---------------------------------	------

No pictures to display