


RENAULT Megane: 1FTQ130

Vinnnumber:	VF1BZ140649729667	Versionname:	MEGANE BER Energy Bose Ed.110PK
First Registrationdate:	22/10/2013	Fiscalpower:	
Expertise Mileage:	72644	Power Kw:	81
Bodytype:		Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	19400KM	Parking lot	4212
Maintenance	OK		
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD	Sun Roof electric
GPS storage	Panoramic roof
GPS storage	SD Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Xenon
Type of GPS	GPS big screen color
Type of Lining	Lining semi-artificial leather
Type of climate control	Autom climate control

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

205/50/17/89 V LightMetal				
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
Total cost ex VAT			621,55
Door R L, Bump(s), Acceptable			0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete)	95,00
---	--------------






Reflector, Broken, E - Replace 28,35



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20

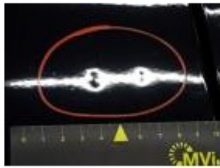

Alloy rim R L polished, Scratch(es), LI - Repair and paint (partial) 0,00



Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00

