



VOLKSWAGEN Passat: 1FQT807

Vinnnumber:	WVWZZZ3CZEE048022	Versionname:	PASSAT VAR Trendline BM
First Registrationdate:	26/09/2013	Fiscalpower:	105PK
Expertise Mileage:	151059	Power Kw:	77
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4424
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage	HD	Luggage cover
GPS storage		Rear parking sensors
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	205/55/16/91 T Steel			
Winter tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1467,86
-------------------	----------------

Bonnet, Hail damage, PDR - Hail	200,00
---------------------------------	---------------





Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Wheel cover F R, Scratch(es), E - Replace 30,00



Wheel cover F L, Scratch(es), E - Replace 30,00



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Wheel cover R R, Broken, E - Replace 30,00



Wing R L, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R L, Scratch(es), E - Replace 30,00




Ignition key, Missing, E - Replace 150,00



Roof, Chemical polution, LI - Repair and paint (complete) 481,50



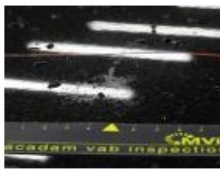

Door F R, Bump(s), Acceptable 0,00

No pictures to display

Door R R, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Interior, Dirty, Cleaning 100,00



Bumper grille F R, Scratch(es), E - Replace 89,00



Rearview mirror L complete, Unclaspd, N - Fit/Remove 0,00

