


BMW 3: 1GAU462

Vinnnumber:	WBA3Y11070D448414	Versionname:	3 GRAN TURISMO 318d
First Registrationdate:	10/12/2013	Fiscalpower:	136PK
Expertise Mileage:	135503	Power Kw:	100
Bodytype:		Body color	Brown
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3811
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	No		

Options

Radio CD	Central consol F
Windows electric F	Rear parking sensors
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	225/55/17/101 V LightMetal			
Winter tyres:	Fr.L.	Firestone: 8 mm	Fr.R.	Firestone: 8 mm
	Re.L.	Fulda: 5 mm	Re.R.	Fulda: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2623,05
Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35




Alloy rim R R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Certificate Of Conformity, Missing, E - Replace 150,00

No pictures to display

Roof, Chemical polution, LI - Repair and paint (complete) 481,50

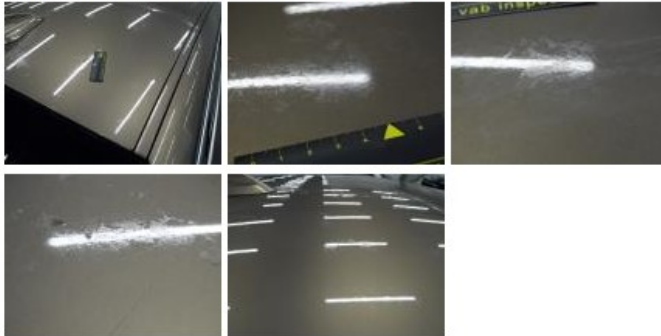

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Bump(s) and scratch(es), Le - Replace and paint 735,00



Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20





Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Registration Document, Missing, E - Replace 150,00

No pictures to display

Interior, Dirty, Cleaning 100,00

