



PEUGEOT 2008: 1GHA493

Vinnumber:	VF3CU9HD8DY075340	Versionname:	2008 e-HDi Allure 115PK
First Registrationdate:	6/02/2014	Fiscalpower:	
Expertise Mileage:	137502	Power Kw:	84
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3522
Maintenance:	DANS 13.500 KM		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

GPS storage		Luggage cover	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear


	195/60/16/89 H LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 7 mm	Fr.R.	Uniroyal: 7 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	1200,84
-------------------	----------------

Bonnet, Chemical polution, LI - Repair and paint (complete)	290,08
-------------------------------------------------------------	---------------

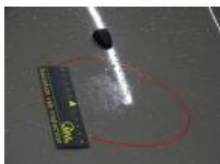

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Bump(s) and scratch(es), E - Replace 415,20



Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Door frame R L, Bump(s) and scratch(es), It - Spot repair 115,56



Interior, Worn, Acceptable 0,00

No pictures to display

Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Tailgate, Bump(s), Acceptable 0,00

No pictures to display

Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00





Wing F R, Scratch(es), Acceptable

0,00

No pictures to display