



RENAULT Clio: 1GMG890

Vinnnumber:	VF15RJLOH50186484	Versionname:	CLIO IV BER e-Expression St&St 90PK
First Registrationdate:	10/03/2014	Fiscalpower:	
Expertise Mileage:	60591	Power Kw:	66
Bodytype:	Hatchback	Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3121
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Windows electric F	Luggage cover
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining fabrics
Type of climate control:	Manual climate control

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	185/65/15/88 T Steel			
Winter tyres:	Fr.L.	Pirelli: 3 mm	Fr.R.	Pirelli: 3 mm
	Re.L.	Pirelli: 4 mm	Re.R.	Pirelli: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1040,26
-------------------	----------------

Wheel cover R R, Scratch(es), E - Replace	24,00
---	--------------



Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	254,68
---	---------------




Wheel cover F R, Scratch(es), E - Replace	24,00
---	--------------




Bonnet, Bump(s), PDR - Knock out without painting	63,00
---	-------



Rocker panel inner R R, Scratch(es), LI - Repair and paint (complete)	115,56
---	--------

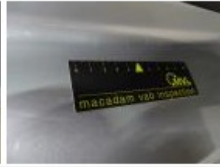


Roof, Bad repair, Paint	0,00
-------------------------	------

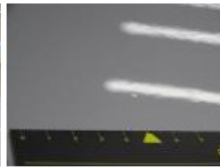

Door R R, Scratch(es), LI - Repair and paint (complete)	254,68
---	--------



Tailgate, Bump(s) and scratch(es), LI - Repair and paint (complete)	241,34
---	--------

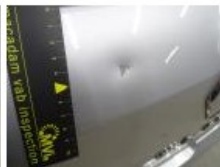

Wing R L, Bump(s), PDR - Knock out without painting	63,00
---	-------

