


RENAULT Scenic: 1JFX275

Vinnnumber:	VF1JZ14K651845365	Versionname:	SCENIC Energy Life 110PK
First Registrationdate:	8/12/2014	Fiscalpower:	
Expertise Mileage:	85862	Power Kw:	81
Bodytype:	Hatchback	Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3729
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Type of Tow bar	Tow bar fixed
Windows electric F			
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Manual climate control		

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear


205/60/16/92 H Steel				
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	573,80
-------------------	--------

Wheel cover F L, Scratch(es), E - Replace	30,00
---	-------

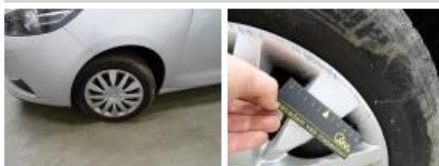

Trunk lid covering R, Scratch(es), Acceptable	0,00
---	------

No pictures to display

Door F R, Repaired, Acceptable	0,00
--------------------------------	------

No pictures to display

Wheel cover F R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Rearview mirror L complete, Broken, F - Replace	168,00
---	--------



Bonnet, Stone chip(s), Acceptable 0,00

No pictures to display

Wing R R, Repaired, Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Door R R, Bump(s), Acceptable 0,00

No pictures to display

Seat cover R, Stain, Cleaning 50,00



Door R R, Repaired, Acceptable 0,00

No pictures to display

Door moulding Lower R R, Scratch(es), E - Replace 114,00

