



RENAULT Grand Scenic: 1ERJ376

Vinnnumber:	VF1JZ14B648479959	Versionname:	GR.SCENIC Energ.Privilege 7pl.FAP 110PK
First Registrationdate:	1/03/2013	Fiscalpower:	
Expertise Mileage:	117644	Power Kw:	81
Bodytype:	MPV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4327
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Seats F heated	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather and alcantara
Type of climate control	Autom climate control

Limited Technical Inspection


Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	205/55/17/95 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Total cost ex VAT	3000,57
Alloy rim R L, Scratch(es), LI - Repair and paint (complete)	95,00

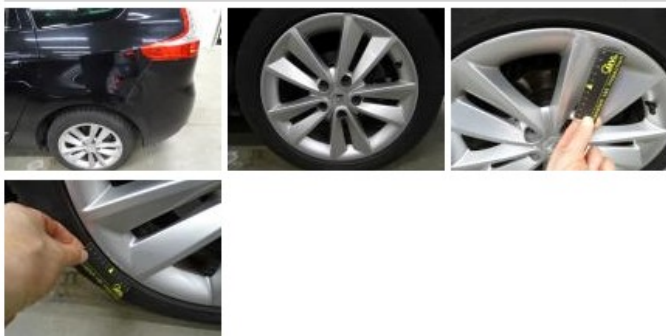

Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Rocker panel inner F L, Bump(s) and scratch(es), LI - Repair and paint (complete)

115,56



Bumper R, Scratch(es), LI - Repair and paint (complete)

211,80



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)

308,20



Door R R, Scratch(es), LI - Repair and paint (complete)

318,35



Door panel R L, Damaged, E - Replace

114,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00



Door F L, Bump(s) and scratch(es), LI - Repair and paint (complete)

318,35



Wing R R, Damaged, E - Replace 98,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete) 290,08



Bumper moulding F R, Damaged, E - Replace 14,40



Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80



Rocker panel inner R L, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Bump(s) and scratch(es), LI - Repair and paint (complete) 301,68



