



RENAULT Megane: 1EJW972

Vinnnumber:	VF1KZ090348224562	Versionname:	MEGANE GT Dynamique EDC 110PK Aut.
First Registrationdate:	2/01/2013	Fiscalpower:	
Expertise Mileage:	153441	Power Kw:	81
Bodytype:	Break	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3706
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Central consol F
GPS storage	SD Rear parking sensors
GPS storage	
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear


	205/55/16/91 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 3 mm	Re.R.	Michelin: 3 mm

Assistance equipment

Total cost ex VAT	2418,55
Luggage space cover, Missing, E - Replace	240,00



Door R R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00

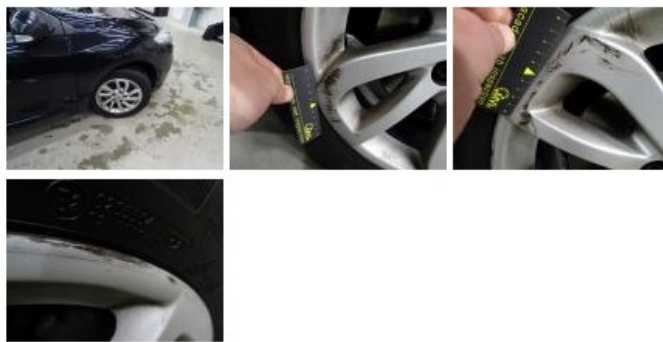

Wing F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof pillar R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof pillar L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00




Bonnet, Chemical polution, LI - Repair and paint (complete)	290,08
---	--------




Bumper F M, Chemical polution, It - Spot repair	115,00
---	--------



Bumper moulding F, Deformed, E - Replace	14,40
--	-------

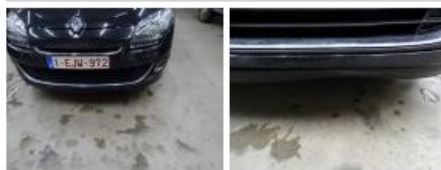

Wing R L, Chemical polution, LI - Repair and paint (complete)	308,20
---	--------

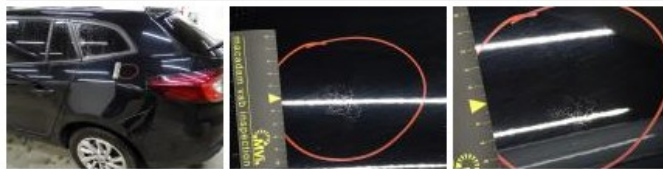

Door F L, Scratch(es), LI - Repair and paint (complete)	318,35
---	--------



Tyre repair kit, Missing, E - Replace	210,53
---------------------------------------	--------

<i>No pictures to display</i>	
-------------------------------	--

Windscreen, Stone chip(s), Acceptable	0,00
---------------------------------------	------

<i>No pictures to display</i>	
-------------------------------	--

Tailgate, Scratch(es), Acceptable	0,00
-----------------------------------	------

<i>No pictures to display</i>	
-------------------------------	--

Rear spoiler, Chemical polution, LI - Repair and paint (complete)	318,35
---	--------



Glove compartment lid, Scratch(es), Smart repair 110,64



Roof, Scratch(es), Acceptable 0,00

No pictures to display

Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Bump(s), PDR - Knock out without painting 63,00



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Interior, Stain, Cleaning 50,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00

