



**SKODA Octavia: 1EDW982**

Vinnnumber:	<b>TMBHT21Z9D2075356</b>	Versionname:	<b>OCTAVIA COMBI GTec Ambition DPF 105PK</b>
First Registrationdate:	<b>2/11/2012</b>	Fiscalpower:	
Expertise Mileage:	<b>142840</b>	Power Kw:	<b>77</b>
Bodytype:	<b>Berline</b>	Body color:	<b>Grey</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2632</b>
Number of doors:	<b>4</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD	Central consol F
GPS storage	Rear parking sensors
GPS storage	<b>HD</b>
Windows electric F	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	<b>Headlighting Halogen</b>
Type of GPS	<b>GPS big screen color</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Autom climate control</b>

**Limited Technical Inspection**

Power steering	<b>Yes</b>	Battery functioning	<b>Yes</b>
Airco functioning	<b>OK</b>	Sound engine	<b>OK</b>
Tires wear profile	<b>OK</b>	Clutch test	<b>OK</b>
Idle position	<b>OK</b>	Wiper fluid level	<b>OK</b>
Engine startingtime	<b>OK</b>	Lighting	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiperblades	<b>OK</b>
Transmission	<b>OK</b>		
Handbrake	<b>OK</b>		

**Degree of wear**

	<b>195/65/15/91 H LightMetal</b>			
Winter tyres:	Fr.L.	<b>Michelin: 6 mm</b>	Fr.R.	<b>Michelin: 6 mm</b>
	Re.L.	<b>Michelin: 5 mm</b>	Re.R.	<b>Michelin: 5 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT	<b>2599,39</b>
-------------------	----------------

Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	<b>95,00</b>
--	--------------



Floor covering F L, Hole, E - Replace	<b>252,00</b>
---------------------------------------	---------------



Wing R L, Stain, 67 - Polish	<b>55,19</b>
------------------------------	--------------



Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Damaged, Le - Replace and paint 1016,70




Ashtray R, Scratch(es), E - Replace 25,00




Roof, Chemical pollution, LI - Repair and paint (complete) 481,50



Rearlight L, Crack, E - Replace 114,00

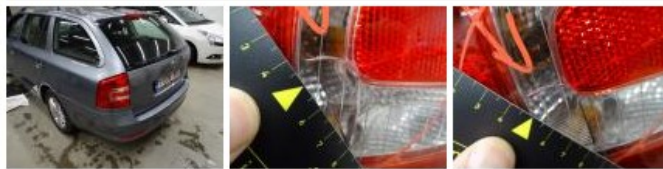

Rear window, Scratch(es), E - Replace 370,00

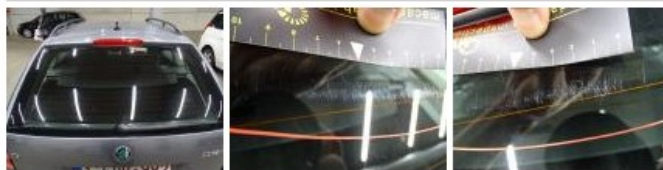

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00





Wing F R, Bad repair, Paint

0,00

