



<b>BMW X3: 1GGX606</b>			
Vinnumber:	<b>WBAWY110300C53613</b>	Versionname:	<b>X3 sDrive18 136PK Aut.</b>
First Registrationdate:	<b>5/02/2014</b>	Fiscalpower:	
Expertise Mileage:	<b>158288</b>	Power Kw:	<b>100</b>
Bodytype:	<b>SUV</b>	Body color:	<b>Black</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>3120</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

<b>Options</b>			
Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	<b>HD</b>	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	<b>Headlighting Halogen</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

<b>Limited Technical Inspection</b>			
Power steering	<b>Yes</b>	Battery functioning	<b>Yes</b>
Airco functioning	<b>OK</b>	Sound engine	<b>OK</b>
Tires wear profile	<b>OK</b>	Clutch test	<b>OK</b>
Idle position	<b>OK</b>	Wiper fluid level	<b>OK</b>
Engine startingtime	<b>OK</b>	Lighting	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiperblades	<b>OK</b>
Transmission	<b>OK</b>		
Handbrake	<b>OK</b>		


<b>Degree of wear</b>				
	<b>225/60/17/99 H LightMetal</b>			
Winter tyres:	Fr.L.	<b>Bridgestone: 3 mm</b>	Fr.R.	<b>Bridgestone: 3 mm</b>
	Re.L.	<b>Bridgestone: 4 mm</b>	Re.R.	<b>Bridgestone: 4 mm</b>

<b>Assistance equipment</b>			
Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
<b>Total cost ex VAT</b>			<b>1295,73</b>
<b>Roof, Chemical polution, LI - Repair and paint (complete)</b>			<b>577,80</b>

<b>Wing R L, Chemical polution, LI - Repair and paint (complete)</b>			
			<b>369,84</b>



Bonnet, Chemical pollution, LI - Repair and paint (complete) 348,09

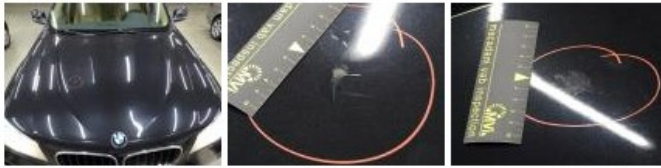

Door R R, Stain, Acceptable 0,00



Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Glove compartment lid, Scratch(es), Acceptable 0,00



Backrest cover F L, Worn, Acceptable 0,00



Wing F L, Bad repair, Paint 0,00

