



**MERCEDES A: 1EPN934**

Vinnumber:	<b>WDD1760121J067589</b>	Versionname:	<b>A 180 CDI BE 109PK</b>
First Registrationdate:	<b>15/02/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>90740</b>	Power Kw:	<b>80</b>
Bodytype:		Body color:	<b>Blue</b>
Gearbox:	<b>MAN 6 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>OK</b>	Parking lot:	<b>2823</b>
Maintenance:	<b>A BINNEN 112 DAGEN</b>		
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>1</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD	Luggage cover
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	<b>Headlighting Xenon</b>
Type of Lining	<b>Lining artificial leather and alcantara</b>
Type of climate control	<b>Manual climate control</b>
Sport seats	

**Limited Technical Inspection**

Power steering	<b>Yes</b>	Battery functioning	<b>Yes</b>
Airco functioning	<b>OK</b>	Sound engine	<b>OK</b>
Tires wear profile	<b>OK</b>	Clutch test	<b>OK</b>
Idle position	<b>OK</b>	Wiper fluid level	<b>OK</b>
Engine startingtime	<b>OK</b>	Lighting	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiperblades	<b>OK</b>
Transmission	<b>OK</b>		
Handbrake	<b>OK</b>		

**Degree of wear**


Winter tyres:	<b>225/40/18/92 V LightMetal</b>			
	Fr.L.	<b>Continental: 7 mm</b>	Fr.R.	<b>Continental: 7 mm</b>
	Re.L.	<b>Continental: 7 mm</b>	Re.R.	<b>Continental: 7 mm</b>

**Assistance equipment**

Runflat	<b>Yes</b>
---------	------------

Total cost ex VAT	<b>1666,00</b>
-------------------	----------------

Wing R R, Bump(s), PDR - Knock out without painting	<b>63,00</b>
---	--------------

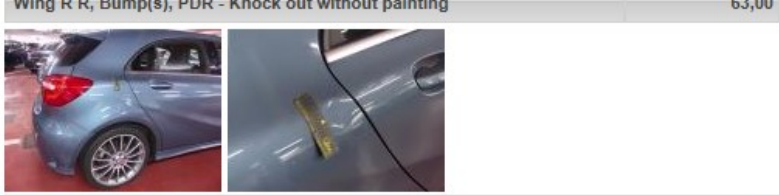

Alloy rim F L polished, Damaged, E - Replace	<b>235,20</b>
--	---------------



Alloy rim R R polished, Damaged, E - Replace 235,20



Alloy rim R L polished, Damaged, LI - Repair and paint (complete) 95,00



Roof, Bump(s), PDR - Knock out without painting 63,00



Door R R, Bump(s), Acceptable 0,00



Seat cover F L, Hole, E - Replace 360,00



Front bumper, Scratch(es), LI - Repair and paint (complete) 259,80



Bumper R, Scratch(es), LI - Repair and paint (complete) 259,80



Alloy rim F R polished, Damaged, LI - Repair and paint (complete) 95,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 259,80

