



AUDI A3: 1ETN833			
Vinnnumber:	WAUZZZ8V6DA041814	Versionname:	A3 SB Attraction 105PK
First Registrationdate:	18/03/2013	Fiscalpower:	
Expertise Mileage:	86474	Power Kw:	77
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3119
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining fabrics
Type of climate control:	Autom climate control

Limited Technical Inspection			
Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear				
	205/55/16/91 T LightMetal			
Winter tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes

Total cost ex VAT	1873,88
Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80




Speaker cover R R, Crack, E - Replace	42,00
---------------------------------------	--------------



Bonnet, Chemical polution, LI - Repair and paint (complete)	290,08
---	---------------



Roof, Chemical polution, LI - Repair and paint (complete) 481,50

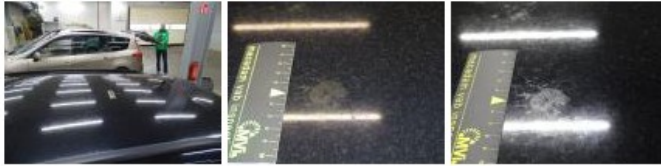

Door F R, Bump(s), LI - Repair and paint (complete) 318,35



Door R R, Chemical polution, LI - Repair and paint (complete) 318,35



Door R R, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80

