


PEUGEOT 508: 1EOX150

Vinnnumber:	VF38D9HL0CL088458	Versionname:	508 BER Active 115PK
First Registrationdate:	11/02/2013	Fiscalpower:	
Expertise Mileage:	150771	Power Kw:	84
Bodytype:	Berline	Body color:	Brown
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2812
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Central consol F
GPS storage	Front parking sensors
GPS storage	HD Rear parking sensors
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control
Head-up Display	

Limited Technical Inspection

Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear

	215/60/16/99 H LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment


Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	573,38
Roof rail R, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Rearlight L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Hail damage, PDR - Hail	0,00





Wing F L, Chemical pollution, LI - Repair and paint (complete)	220,18
--	--------

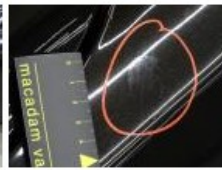

Engine protective plate, Hole, E - Replace	45,00
--	-------





Tailgate, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Wing R R, Chemical pollution, LI - Repair and paint (complete)	308,20
--	--------



Bonnet, Hail damage, PDR - Hail	0,00
---------------------------------	------

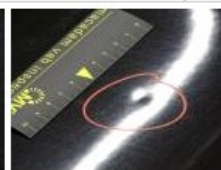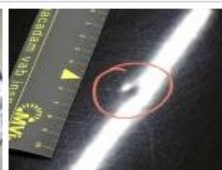

Rearview mirror housing R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Windscreen, Stone chip(s), Acceptable	0,00
---------------------------------------	------

No pictures to display

Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display