




AUDI A4: 1JFY711			
Vinnumber:	WAUZZZ8K4FA078093	Versionname:	A4 BER Ultra 136PK
First Registrationdate:	8/12/2014	Fiscalpower:	
Expertise Mileage:	119213	Power Kw:	100
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3405
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options			
Radio CD		Central consol F	
GPS storage	DVD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar removable
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Radio multimedia			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Power steering	Yes	Battery functioning	Yes
Airco functioning	OK	Sound engine	OK
Tires wear profile	OK	Clutch test	OK
Idle position	OK	Wiper fluid level	OK
Engine startingtime	OK	Lighting	OK
Exhaust gass	OK	Wiperblades	OK
Transmission	OK		
Handbrake	OK		

Degree of wear				
	205/60/16/92 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment	
Emergency spare wheel	Yes Jack Yes
Total cost ex VAT	1363,28
Rearview mirror housing R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	308,20

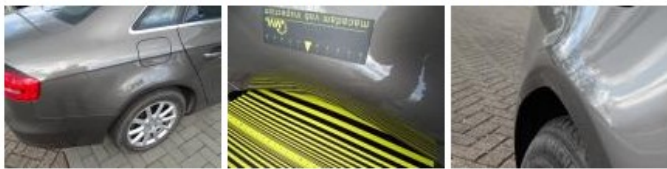



Wing R L, Scratch(es), LI - Repair and paint (complete) 308,20



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Grill, Damaged, E - Replace 125,00



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover R R, Stain, Cleaning 25,00



Door R R, Bump(s), Acceptable 0,00

No pictures to display


Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Door frame R R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

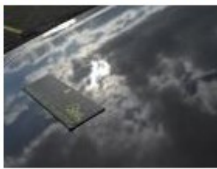

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00

