



AUDI A3: 1GMQ944			
Vinnumber:	WAUZZZ8V4EA151536	Versionname:	A3 SB Attraction 105PK
First Registrationdate:	12/03/2014	Fiscalpower:	
Expertise Mileage:	81067	Power Kw:	77
Bodytype:		Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1222
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Xenon
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/45/17/91 H LightMetal			
Summer tyres:	Fr.L.	Semperit: 7 mm	Fr.R.	Semperit: 7 mm
	Re.L.	Semperit: 7 mm	Re.R.	Semperit: 7 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			2443,77
Roof pillar R, Bump(s), LI - Repair and paint (complete)			220,18



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
--	--------------






Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F L, Bump(s), LI - Repair and paint (complete) 318,35

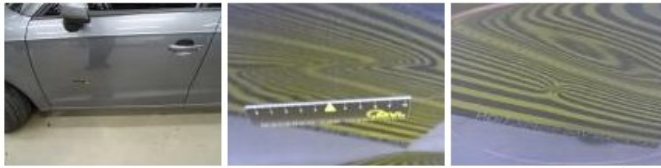

Door F R, Bump(s), PDR - Knock out without painting 63,00



Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Roof, Hail damage, PDR - Hail 0,00



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20




Roof pillar L, Bump(s), LI - Repair and paint (complete) 220,18



Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08



Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80

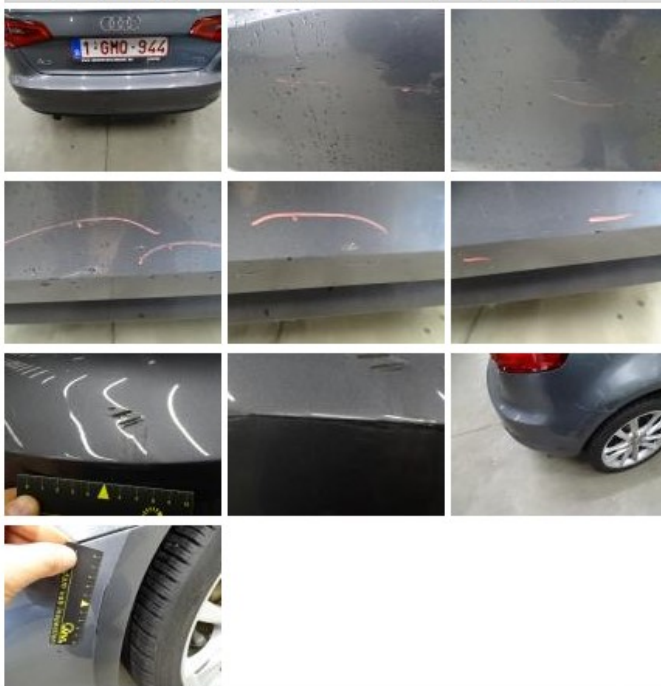

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00





Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 220,18

