



BMW 3: 1GF1103

Vinnumber:	WBA3K11020F829688	Versionname:	3 TOURING 318d 136PK
First Registrationdate:	23/01/2014	Fiscalpower:	
Expertise Mileage:	107807	Power Kw:	100
Bodytype:	Break	Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4715
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Sun Roof electric
GPS storage		Panoramic roof
GPS storage	HD	Central consol F
Windows electric F		Luggage cover
Windows electric R		Rear parking sensors
Cruise Control		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/96 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------


Total cost ex VAT	425,80
Door panel F L, Tear, E - Replace	114,00



Gear shift lever cover, Tear, E - Replace	25,00
---	--------------



Interior, Stain, Cleaning 50,00

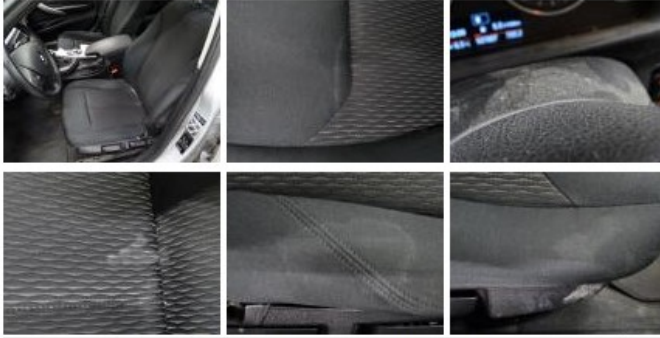

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Backrest cover R L, Dirty, Cleaning 25,00



Alloy rim R L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display