


SKODA Octavia: 1GEF649

Vinnnumber:	TMBAG7NE1E0136402	Versionname:	OCTAVIA BER Ambition
First Registrationdate:	14/01/2014	Fiscalpower:	105PK
Expertise Mileage:	153139	Power Kw:	77
Bodytype:	Hatchback	Body color:	Grey
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3816
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage	SD	Front parking sensors
GPS storage		Rear parking sensors
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 T LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 7 mm	Fr.R.	Uniroyal: 7 mm
	Re.L.	Semperit: 4 mm	Re.R.	Semperit: 4 mm

Assistance equipment

Repair kit	No	Compressor	Yes
------------	-----------	------------	------------

Total cost ex VAT	881,03
Front bumper, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing R L, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Door R L, Bump(s), PDR - Knock out without painting	63,00



Door F L, Bump(s), PDR - Knock out without painting

63,00




Door F R, Bad repair, Paint	0,00
-----------------------------	------




Door R R, Bad repair, Paint	0,00
-----------------------------	------



Roof, Rust, LI - Repair and paint (complete)	481,50
--	--------

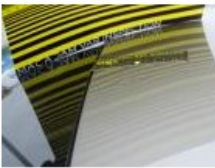

Wing F R, Bump(s), PDR - Knock out without painting	63,00
---	-------

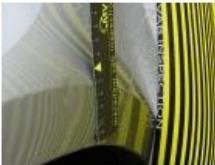

Tyre repair kit, Incomplete, E - Replace	210,53
--	--------

