


RENAULT Grand Scenic: 1ERM151

Vinnumber:	VF1JZ14B648480392	Versionname:	GR.SCENIC Energ.Dynamique 7pl.FAP
First Registrationdate:	1/03/2013	Fiscalpower:	110PK
Expertise Mileage:	225031	Power Kw:	81
Bodytype:	MPV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2411
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining semi-leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/96 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment


Total cost ex VAT	340,18
Seat cover R R, Stain, Cleaning	25,00




Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door R R, Scratch(es), LI - Repair and paint (complete)	0,00



Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 0,00

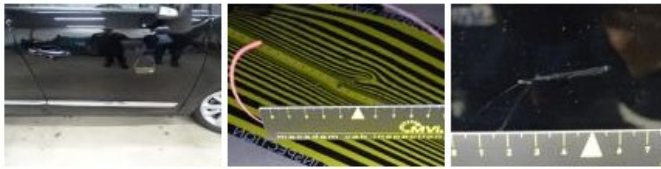

Roof pillar R, Chemical polution, LI - Repair and paint (complete) 220,18

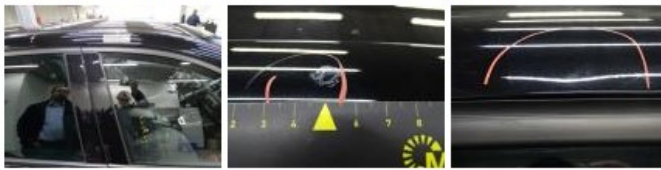


Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00




Seat cover F L, Worn, Acceptable 0,00



Roof, Chemical polution, LI - Repair and paint (complete) 0,00

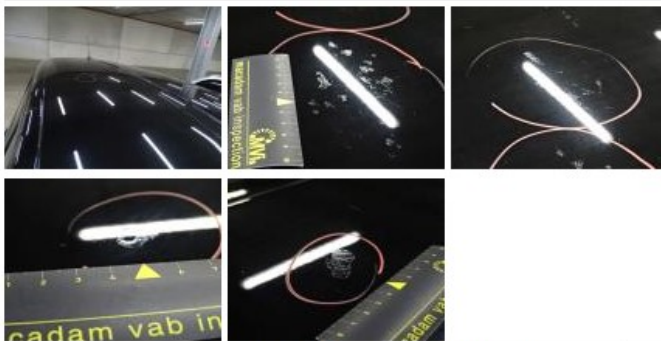

Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 0,00

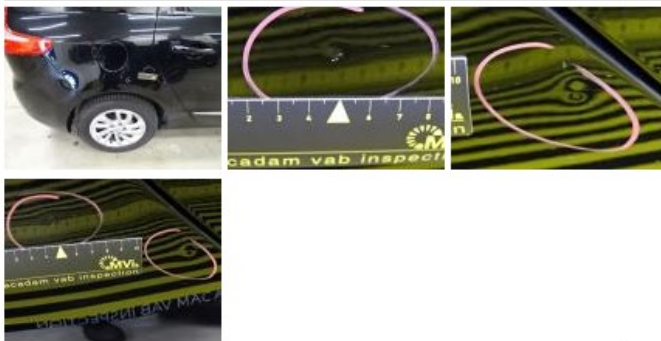

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Bad repair, Acceptable	0,00
--------------------------------------	------

No pictures to display

Alloy rim F L, Scratch(es), Acceptable	0,00
--	------

No pictures to display