


AUDI A3: 1GNJ709

Vinnnumber:	WAUZZZ8V7EA154690	Versionname:	A3 SB Attraction 105PK
First Registrationdate:	18/03/2014	Fiscalpower:	
Expertise Mileage:	169125	Power Kw:	77
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4505
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/55/16/91 V LightMetal				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	1521,91
Alloy rim F R, Scratch(es), Acceptable	0,00

No pictures to display


Wing F L, Scratch(es), LI - Repair and paint (complete)	220,18
---	---------------



Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80
---	---------------



Roof, Chemical polution, LI - Repair and paint (complete)	481,50
---	--------

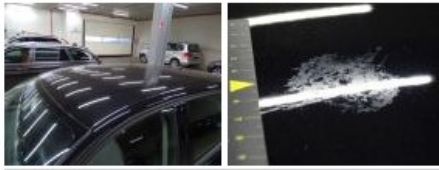

Wing R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Door F L, Bump(s), Acceptable	0,00
-------------------------------	------

No pictures to display

Front bumper, Scratch(es), Acceptable	0,00
---------------------------------------	------

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete)	290,08
---	--------



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	--------

