



AUDI A3: 1HXG298			
Vinnumber:	WAUZZZ8V1FA067997	Versionname:	A3 SB Ultra Attraction
First Registrationdate:	21/10/2014	Fiscalpower:	110PK
Expertise Mileage:	108065	Power Kw:	81
Bodytype:	Hatchback	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4728
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	SD Rear parking sensors
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
Winter tyres:	205/55/16/91 H LightMetal			
	Fr.L.	Michelin: 3,5 mm	Fr.R.	Michelin: 3,5 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment	
Total cost ex VAT	1415,43
Door F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00



Ignition key, Not functioning (well), P - Check	0,00
---	------




Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Sill outer R, Damaged, Le - Replace and paint 712,00



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35

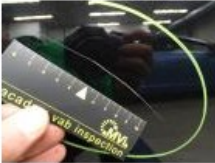

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

