



HONDA JAZZ: 1HER125

Vinnumber:	LUCGE375073203010	Versionname:	
First Registrationdate:		Fiscalpower:	
Expertise Mileage:	76839	Power Kw:	81
Bodytype:		Body color:	Red
Gearbox:	MAN 5 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Steel
Fueltype:	Petrol	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1114
Number of doors:	5		
Number of seats:	5		
Number head rests:	4		
Rims summer:	Steel		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Luggage cover	
Windows electric F			
Steering wheel multifunctional			
Type of headlighting:	Headlighting Halogen		
Type of Lining:	Lining fabrics		
Type of climate control:	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	175/65/14/82 T Steel			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Emergency spare wheel	Yes
-----------------------	------------

Total cost ex VAT	4826,99
Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)	115,56

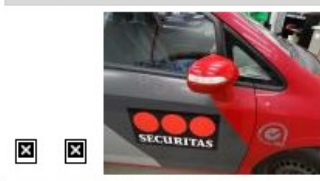

Wheel cover F L, Missing, E - Replace	24,00
---------------------------------------	-------



Bodywork, Not original part, Acceptable 0,00

No pictures to display

Door F L, Bump(s), Acceptable 0,00

No pictures to display

Roof pillar R, Hail damage, PDR - Hail 150,00



Wing R R, Hail damage, PDR - Hail 125,00



Wheel cover R L, Missing, E - Replace 24,00



Bonnet, Bump(s), Le - Replace and paint 827,76





Roof, Bump(s) and scratch(es), Le - Replace and paint 1546,27



Roof pillar L, Hail damage, PDR - Hail 450,00



Door F R, Bump(s), Acceptable 0,00

No pictures to display

Wheel cover F R, Missing, E - Replace 24,00





Tailgate, Bump(s), Acceptable 0,00

No pictures to display

Ignition key, Missing, E - Replace 150,00



Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 246,56



Trunk lid covering R, Incomplete, E - Replace 74,00



Wheel cover R R, Scratch(es), E - Replace 24,00



Interior, Stain, Cleaning 100,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 169,44





Front bumper, Scratch(es), LI - Repair and paint (complete) 169,44



Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 254,68



Wing F L, Bump(s) and scratch(es), LI - Repair and paint (complete) 176,14



Wing F R, Scratch(es), LI - Repair and paint (complete) 176,14

