



MINI CABRIO: 1JTS780

Vinnnumber:	WMWZN31060T604320	Versionname:	1.6 COOPER CABRIO (122HP)
First Registrationdate:	23/02/2015	Fiscalpower:	
Expertise Mileage:	119447	Power Kw:	90
Bodytype:	Cabriolet	Body color:	Dark Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Petrol	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1205
Number of doors:	2		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Luggage cover
Windows electric F	Front parking sensors
Seats F heated	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of Lining:	Lining leather
Type of climate control:	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	175/65/15/84 H LightMetal			
Summer tyres:	Fr.L.	Michelin: 2 mm	Fr.R.	Michelin: 2 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1043,99
--------------------------	----------------

Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete)	211,80
--	---------------




Front bumper, Stone chip(s), Acceptable	0,00
--	-------------

No pictures to display

Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	308,20
--	---------------



Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
--	---------------

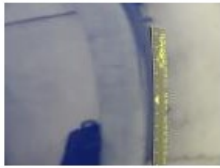

Rearview mirror housing R, Scratch(es), Smart repair	110,64
--	--------



Alloy rim F R, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------



Rearview mirror housing L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Alloy rim F L, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Rear window, Scratch(es), E - Replace	0,00
---------------------------------------	------

