



RENAULT Megane: 1ECK390

Vinnumber:	VF1KZ140647876844	Versionname:	MEGANE GT Energy PrivilEge 110PK
First Registrationdate:	19/10/2012	Fiscalpower:	
Expertise Mileage:	184587	Power Kw:	81
Bodytype:	Break	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2515
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Central consol F	
GPS storage	SD	Luggage cover	
GPS storage		Rear parking sensors	
Windows electric F		Type of Tow bar	Tow bar fixed
Windows electric R			
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather and alcantara		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	205/50/17/93 T LightMetal			
Summer tyres:	Fr.L.	Semperit: 4 mm	Fr.R.	Semperit: 4 mm
	Re.L.	Semperit: 6,5 mm	Re.R.	Semperit: 6,5 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	4226,02
Door R R, Scratch(es), LI - Repair and paint (complete)	318,35

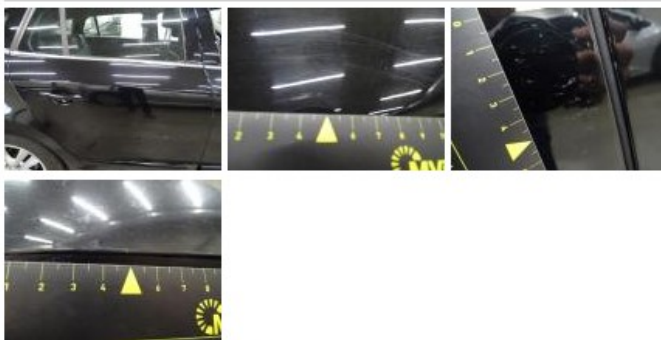

Bumper corner R L, Scratch(es), It - Spot repair	115,56
--	--------



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Door F R, Scratch(es), LI - Repair and paint (complete) 318,35



Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20



Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Rear window, Scratch(es), E - Replace 370,00




Bumper corner R R, Scratch(es), It - Spot repair 115,56



Rearlight R , Crack, E - Replace 114,00



Interior, Dirty, Acceptable 0,00

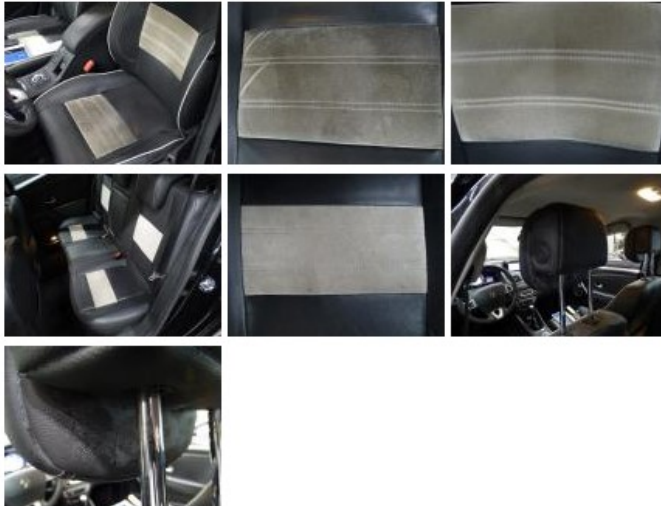

Door trim R R, Scratch(es), LI - Repair and paint (complete) 110,00




Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete) 290,08




Alloy rim F L, Scratch(es), Acceptable 0,00

No pictures to display

Roof, Bump(s) and scratch(es), LI - Repair and paint (complete) 481,50

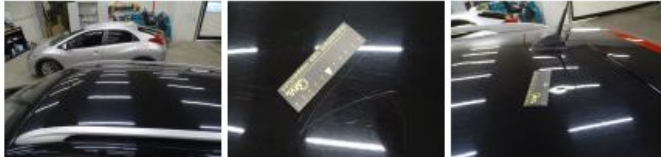


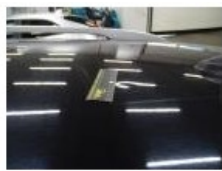

Door trim F R, Scratch(es), LI - Repair and paint (complete) 110,00



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20

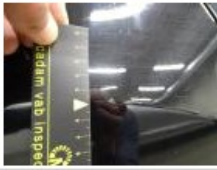

Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Tyre F R, Damaged, E - Replace 132,00



Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56



Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Scratch(es), LI - Repair and paint (complete) 220,18

