



**VOLKSWAGEN Caddy: 1FHJ826**

Vinnnumber:	<b>WV2ZZZ2KZEX011890</b>	Versionname:	<b>CADDY LIFE Baseline BM</b>
First Registrationdate:	<b>3/07/2013</b>	Fiscalpower:	<b>75PK</b>
Expertise Mileage:	<b>114245</b>	Power Kw:	<b>55</b>
Bodytype:	<b>Transporter</b>	Body color:	<b>White</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Opaque</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>1209</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD	Luggage cover
Cruise Control	
Type of headlighting	<b>Headlighting Halogen</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Manual climate control</b>

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>195/65/15/95 H Steel</b>			
Winter tyres:	Fr.L.	<b>Goodyear: 5 mm</b>	Fr.R.	<b>Goodyear: 5 mm</b>
	Re.L.	<b>Goodyear: 6 mm</b>	Re.R.	<b>Goodyear: 6 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT	<b>833,19</b>
-------------------	---------------

Side window R R, Scratch(es), E - Replace	<b>0,00</b>
---	-------------



Bodywork, Not original part, Acceptable	<b>0,00</b>
---	-------------

No pictures to display


Wing R R, Scratch(es), LI - Repair and paint (complete)	<b>231,15</b>
---	---------------



Front bumper, Scratch(es), Acceptable	<b>0,00</b>
---------------------------------------	-------------

No pictures to display

Bonnet, Bump(s), PDR - Knock out without painting	<b>63,00</b>
---	--------------

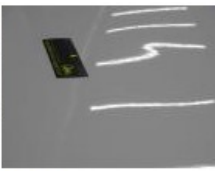


Wing R L, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Supplementary brake lights, Damaged, E - Replace	33,00
--	-------



Bumper R, Scratch(es), Smart repair	110,64
-------------------------------------	--------

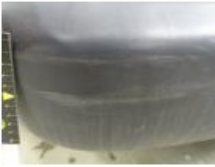

Windscreen, Crack, E - Replace	395,40
--------------------------------	--------

