


RENAULT Grand Scenic: 1ENU571

Vinnnumber:	VF1JZ14A648563043	Versionname:	GR.SCENIC Energ.Bose
First Registrationdate:	1/02/2013	Fiscalpower:	Edit.5pl.FAP 110PK
Expertise Mileage:	95373	Power Kw:	81
Bodytype:	MPV	Body color:	Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3230
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	SD Rear parking sensors
Windows electric F	
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining semi-leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/17/95 H LightMetal			
Winter tyres:	Fr.L.	Pirelli: 5 mm	Fr.R.	Pirelli: 5 mm
	Re.L.	Continental: 6 mm	Re.R.	Continental: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2623,66
Wing F L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Roof, Chemical polution, LI - Repair and paint (complete)	481,50



Wing R R, Bump(s), LI - Repair and paint (complete)	308,20
---	--------



Seat cover F L, Stain, Acceptable 0,00



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), Acceptable 0,00

No pictures to display



Alloy rim F L polished, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R polished, Scratch(es), E - Replace 235,20



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80

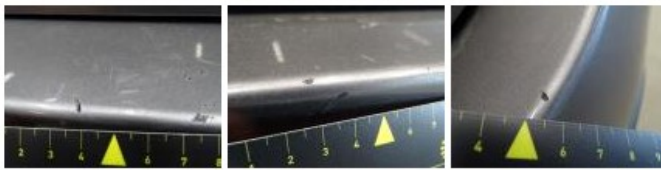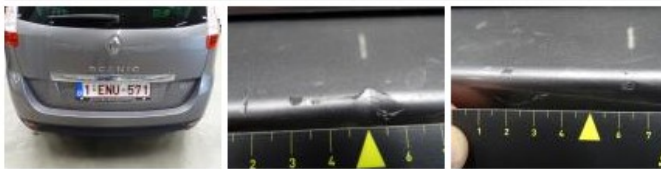

Seat cover F L, Worn, Acceptable 0,00




Wing F R, Scratch(es), LI - Repair and paint (complete) 220,18



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



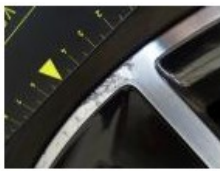

Engine protective plate, Tear, E - Replace 50,00



Ceiling, Dirty, Acceptable 0,00



Alloy rim R L polished, Scratch(es), LI - Repair and paint (complete) 95,00




Rear window, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08



Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35

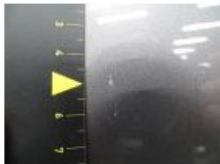

Front bumper, Scratch(es), Acceptable 0,00

No pictures to display