




CITROEN C4 Picasso: 1EWR396			
Vinnnumber:	VF7UA9HR8DJ544705	Versionname:	GR.C4 PICASSO Bus.GPS
First Registrationdate:	9/04/2013	Fiscalpower:	FAP 112PK
Expertise Mileage:	116737	Power Kw:	82
Bodytype:	Hatchback	Body color:	Purple
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1525
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options	
Radio CD	Luggage cover
Windows electric F	Rear parking sensors
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining fabrics
Type of climate control:	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	215/55/16/97 H LightMetal			
Winter tyres:	Fr.L.	Uniroyal: 5 mm	Fr.R.	Uniroyal: 5 mm
	Re.L.	Uniroyal: 6 mm	Re.R.	Uniroyal: 6 mm

Assistance equipment			
Emergency spare wheel	Yes	Jack	Yes
Total cost ex VAT	2168,33		
Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35		

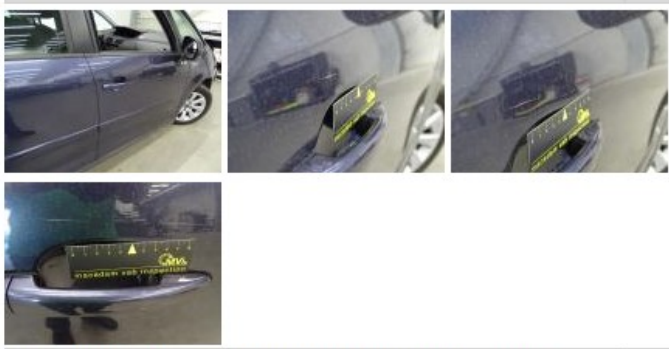

Door F L, Bump(s) and scratch(es), LI - Repair and paint (complete)	318,35
---	---------------



Wing R L, Scratch(es), LI - Repair and paint (complete) 308,20



Door R L, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00




Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20



Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

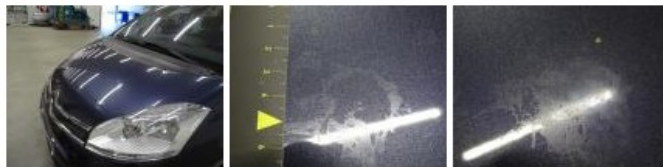

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Wing F R, Scratch(es), Acceptable 0,00

No pictures to display