



CITROEN C4 Picasso: 1EHS778

Vinnnumber:	VF7UD9HR8CJ765441	Versionname:	C4 PICAS.e-HDi Bus.GPS FAP BMP 112PK Aut
First Registrationdate:	6/12/2012	Fiscalpower:	
Expertise Mileage:	195129	Power Kw:	82
Bodytype:	Hatchback	Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3233
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Luggage cover
Windows electric F	Rear parking sensors
Windows electric R	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	215/55/16/93 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	590,36
Wing R L, Scratch(es), LI - Repair and paint (complete)	0,00

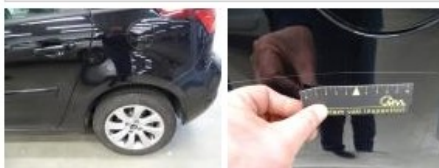

Moulding windscreen L, Deformed, Acceptable	0,00
---	------

No pictures to display

Front bumper, Scratch(es), Acceptable	0,00
---------------------------------------	------

No pictures to display


Ignition key, Missing, E - Replace	150,00
------------------------------------	--------

No pictures to display

Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display


Wing F L, Scratch(es), LI - Repair and paint (complete)	220,18
---	--------

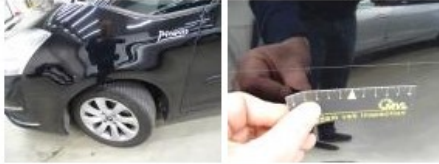

Wing F R, Scratch(es), LI - Repair and paint (complete)	220,18
---	--------



Door R R, Scratch(es), LI - Repair and paint (complete)	0,00
---	------

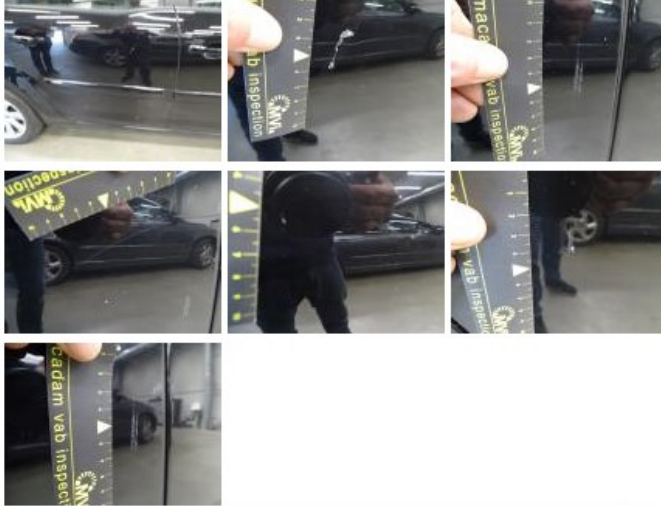

Door R L, Scratch(es), LI - Repair and paint (complete)	0,00
---	------



Rear window, Scratch(es), Acceptable	0,00
--------------------------------------	------

No pictures to display

Bonnet, Scratch(es), Acceptable	0,00
---------------------------------	------

No pictures to display