



FORD Grand C-Max: 1FPV325			
Vinnnumber:	WFOHXXWPBHDG22958	Versionname:	GR.C-MAX Titanium St/St
First Registrationdate:	18/09/2013	Fiscalpower:	115PK
Expertise Mileage:	123378	Power Kw:	85
Bodytype:		Body color:	Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:		Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2527
Number of doors:	5		
Number of seats:	4		
Number head rests:	4		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		


Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Seats F heated	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining leather
Type of climate control:	Autom climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear				
Winter tyres:	215/55/16/93 H LightMetal			
	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Continental: 7 mm	Re.R.	Continental: 7 mm

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			805,88
Door F R, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Door R L, Bump(s) and scratch(es), Le - Replace and paint			0,00



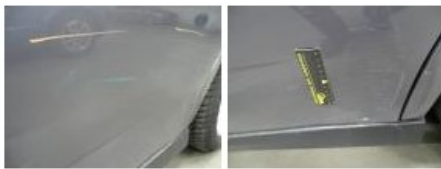

Bonnet, Chemical polution, LI - Repair and paint (complete) 290,08

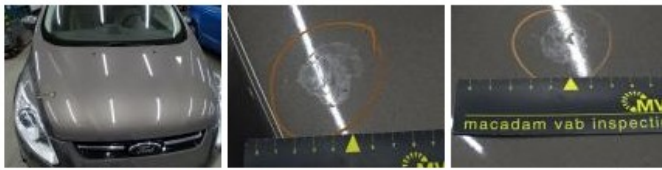

Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Bump(s) and scratch(es), Le - Replace and paint 0,00



Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00



Sill outer R, Scratch(es), It - Spot repair 0,00



Front bumper, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 0,00



Sill outer L, Damaged, Le - Replace and paint 0,00




Rearview mirror housing L, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



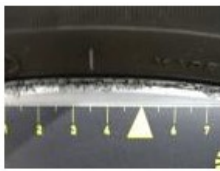

Wing R R, Scratch(es), LI - Repair and paint (complete) 0,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80



Rearlight L, Damaged, E - Replace 114,00

