


BMW 3: 1ESH206

Vinnumber:	WBA3D91030F404831	Versionname:	3 BER 316d 116PK
First Registrationdate:	7/03/2013	Fiscalpower:	
Expertise Mileage:	90366	Power Kw:	85
Bodytype:		Body color:	Blue
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OVER 240 KM	Parking lot:	3804
Maintenance:	OK		
Battery functioning:	Yes		
Number of doors:	4		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage	HD	Rear parking sensors
GPS storage		
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Radio multimedia		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining fabrics	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/60/16/92 H LightMetal			
Winter tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 4 mm	Re.R.	Goodyear: 4 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	1065,70
-------------------	---------

Maintenance, Maintenance, P - Check	0,00
-------------------------------------	------



Bumper F L, Scratch(es), Acceptable	0,00
-------------------------------------	------



Door R L, Bump(s), Acceptable 0,00



Wing R L, Scratch(es), Acceptable 0,00



Alloy rim F R, Scratch(es), Acceptable 0,00




Bumper corner R R, Scratch(es), It - Spot repair 115,56



Bumper F R, Scratch(es), It - Spot repair 115,56



Bonnet, Bump(s), LI - Repair and paint (complete) 290,08

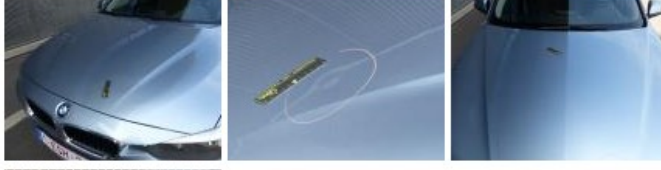

Door F R, Bump(s), Acceptable 0,00



Door F R, Bump(s), PDR - Knock out without painting 63,00



Door R R, Bump(s), Acceptable 0,00



Roof, Bump(s), LI - Repair and paint (complete) 481,50

