


**BMW X3: 1ENG017**

Vinnumber:	<b>WBAWY310700A79265</b>	Versionname:	<b>X3 xDrive20 163PK Aut.</b>
First Registrationdate:	<b>29/01/2013</b>	Fiscalpower:	
Expertise Mileage:	<b>135882</b>	Power Kw:	<b>120</b>
Bodytype:	<b>SUV</b>	Body color:	<b>Grey</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>4 Weel</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Maintenance:	<b>OK</b>	Parking lot:	<b>4102</b>
Battery functioning:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

**Options**

Radio CD		Seats electric F L
GPS storage	<b>HD</b>	Seats electric F R
GPS storage		Central consol F
Windows electric F		Luggage cover
Windows electric R		Front parking sensors
Cruise Control		Rear parking sensors
Steering wheel multifunctional		
Seats F heated		
Type of headlighting	<b>Headlighting Halogen</b>	
Type of GPS	<b>GPS big screen color</b>	
Type of Lining	<b>Lining leather</b>	
Type of climate control	<b>Autom climate control</b>	

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>225/60/17/99 H LightMetal</b>			
Winter tyres:	Fr.L.	<b>Pirelli: 5 mm</b>	Fr.R.	<b>Pirelli: 5 mm</b>
	Re.L.	<b>Pirelli: 5 mm</b>	Re.R.	<b>Pirelli: 5 mm</b>

**Assistance equipment**

Repair kit	<b>Yes</b>	Compressor	<b>Yes</b>
------------	------------	------------	------------

Total cost ex VAT	2396,51
Centre console, Missing, E - Replace	15,00



Alloy rim R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Bumper F R, Scratch(es), It - Spot repair	115,56



Bumper R, Bump(s) and scratch(es), Le - Replace and paint 766,80



Door R L, Scratch(es), LI - Repair and paint (complete) 382,02



Door R R, Bump(s), Acceptable 0,00

No pictures to display


Door moulding Lower R L, Scratch(es), E - Replace 132,00



Windscreen, Stone chip(s), E - Replace 560,64



Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 312,21

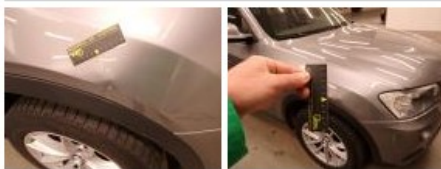

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing moulding F R, Scratch(es), E - Replace 17,28

