



CITROEN DS5: 1FTK007

Vinnnumber:	VF7KF9HD8D5514664	Versionname:	DS5 e-HDi Bus.GPS Plus BMP 113PK Aut.
First Registrationdate:	18/10/2013	Fiscalpower:	
Expertise Mileage:	194859	Power Kw:	84
Bodytype:		Body color:	Black
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	-8500 KM	Parking lot:	3121
Maintenance:	NOT OK		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Seats electric F L
GPS storage		Seats electric F R
GPS storage	HD	Panoramic roof
Windows electric F		Central consol F
Windows electric R		Luggage cover
Cruise Control		Front parking sensors
Steering wheel multifunctional		Rear parking sensors
Seats F heated		
Type of headlighting	Headlighting Halogen	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/60/16/99 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 3 mm	Re.R.	Michelin: 3 mm

Assistance equipment

Emergency spare wheel	Yes
-----------------------	------------

Total cost ex VAT	1365,93
-------------------	---------


Engine protective plate, Hole, E - Replace	35,00
--	-------



Alloy rim F L polished, Rust, Acceptable	0,00
--	------



Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20

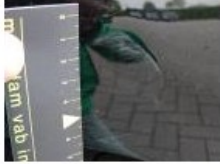

Instrument panel complete, Worn, Acceptable 0,00



GPS, Not functioning (well), P - Check 0,00

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Maintenance, Maintenance, Execute 0,00



Ignition key, Missing, E - Replace 150,00



Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Interior, Smell, Ozone treatment 152,58



Door R R, Scratch(es), LI - Repair and paint (complete) 318,35



Alloy rim R L polished, Rust, Acceptable 0,00

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Luggage space cover, Not functioning (well), P - Check 0,00

