



VOLKSWAGEN Passat: 1GRP473

Vinnnumber:	WVWZZZ3CZEE134197	Versionname:	PASSAT VAR Comfortline
First Registrationdate:	9/04/2014	Fiscalpower:	BMT DSG 105PK Aut
Expertise Mileage:	182414	Power Kw:	77
Bodytype:		Body color:	Green
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	2613
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F	
GPS storage		Luggage cover	
GPS storage	HD	Front parking sensors	
Windows electric F		Rear parking sensors	
Windows electric R		Type of Tow bar	Tow bar fixed
Cruise Control			
Steering wheel multifunctional			
Type of headlighting	Headlighting Halogen		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	215/55/16/97 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	145,00
-------------------	---------------

Wing R R, Bump(s), Acceptable	0,00
-------------------------------	-------------

No pictures to display

Front bumper, Scratch(es), Acceptable	0,00
---------------------------------------	-------------

No pictures to display

Boot carpet, Stain, Acceptable	0,00
--------------------------------	-------------



Bonnet, Bump(s), Acceptable	0,00
-----------------------------	-------------

No pictures to display


Seat cover R R, Stain, Cleaning

50,00



Windscreen, Stone chip(s), E - Replace

0,00

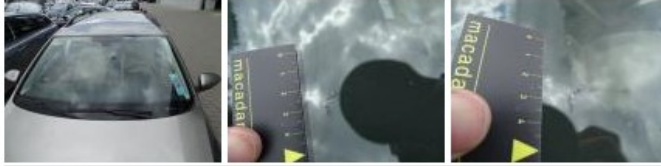

Alloy rim R R, Scratch(es), LI - Repair and paint (complete)

95,00

