



CITROEN Jumpy: 956BHB			
Vinnumber:	VF7XS9HUC9Z048181	Versionname:	JUMPY B/F SWB L1H1 Fresh 90PK
First Registrationdate:	4/02/2010	Fiscalpower:	
Expertise Mileage:	139585	Power Kw:	66
Bodytype:	Transporter	Body color:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:		Rims summer:	Steel
Fueltype:	Diesel		
Maintenance	- 4300KM		
Maintenance	NOT OK		
Battery functioning	No		
Number of doors	5		
Number of seats	3		
Number head rests	3		
Rims summer	Steel		
Category	Light Commercial Vehicle		
Registration Certificate Car (BE)	No		

Options	
Radio CD	
Windows electric F	
Type of headlighting	Headlighting Halogen
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection			
Engine startingtime	NOT OK	Battery functioning	No

Degree of wear			
Summer tyres:	215/65/15/104 H LightMetal		
	Fr.L.	Fr.R.	
	Michelin: 8 mm	Michelin: 8 mm	
	Re.L.	Re.R.	
	Michelin: 9 mm	Michelin: 9 mm	

Assistance equipment			
Spare wheel	Yes	Jack	Yes

Total cost ex VAT	2586,56
-------------------	----------------

Trunk door R R, Bump(s), Acceptable	0,00
-------------------------------------	-------------





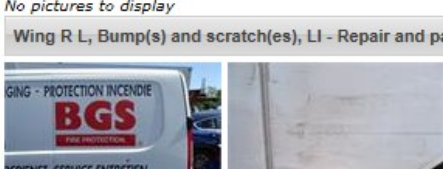
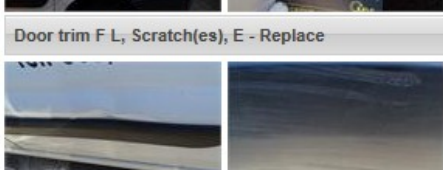
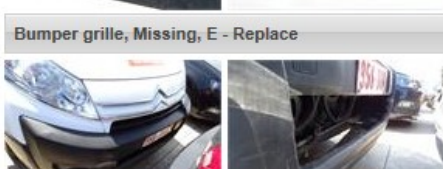
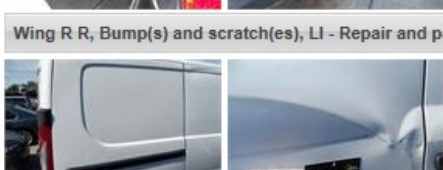
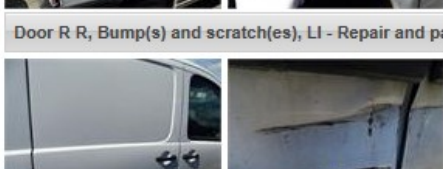

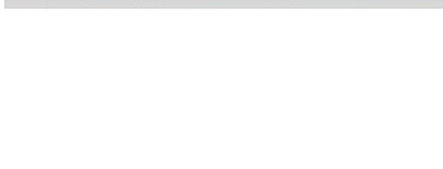
<i>No pictures to display</i>	
Front bumper, Damaged, E - Replace	398,40



Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete)	238,76
---	---------------



Bumper R, Crack, E - Replace	329,40
------------------------------	---------------

	Door R L, Bump(s), PDR - Knock out without painting	159,00
	Rearview mirror housing R, Scratch(es), E - Replace	75,00
	Sill outer R, Bump(s) and scratch(es), LI - Repair and paint (complete)	232,88
	Door F L, Bump(s), Acceptable	0,00
<i>No pictures to display</i>		
	Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	231,15
	Door trim F L, Scratch(es), E - Replace	91,50
	Bumper grille, Missing, E - Replace	30,30
	Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	231,15
	Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	238,76
	Headlight R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>		
	Wing F R, Bump(s) and scratch(es), LI - Repair and paint (complete)	165,13



Wing F L, Bump(s) and scratch(es), LI - Repair and paint (complete) 165,13



Maintenance, Maintenance, Execute 0,00

No pictures to display