


BMW 3: 1GUK457

Vinnnumber:	WBA3Y11080D449667	Versionname:	3 GRAN TURISMO 318d
First Registrationdate:	5/05/2014	Fiscalpower:	136PK
Expertise Mileage:	121763	Power Kw:	100
Bodytype:	Hatchback	Body color:	Silver
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Back	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	1613
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS base
Type of Lining	Lining fabrics
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK


Degree of wear

	225/55/17/97 H LightMetal			
Winter tyres:	Fr.L.	Goodyear: 6 mm	Fr.R.	Goodyear: 6 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	994,98
Roof, Chemical polution, LI - Repair and paint (complete)	481,50

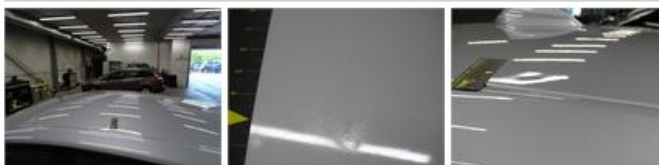

Moulding windscreen R, Damaged, Acceptable	0,00
--	------

No pictures to display

Tailgate, Scratch(es), LI - Repair and paint (complete)	301,68
---	--------



Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80
---	--------

