



FORD TRANSIT: 1KAZ097			
Vinnumber:	WF0SXXWPGSHJ72656	Versionname:	CONNECT
First Registrationdate:	3/04/2017	Fiscalpower:	
Expertise Mileage:	22105	Power Kw:	88
Bodytype:	Transporter	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Steel
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	4125
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Rims summer:	Steel		
Category:	Light Commercial Vehicle		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options	
Radio CD	Rear parking sensors
Windows electric F	
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting:	Headlighting Halogen
Type of GPS:	GPS big screen color
Type of Lining:	Lining fabrics
Type of climate control:	Manual climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	205/60/16/96 H Steel			
Summer tyres:	Fr.L.	Continental: 2 mm	Fr.R.	Continental: 2 mm
	Re.L.	Continental: 3 mm	Re.R.	Continental: 3 mm

Assistance equipment	
Total cost ex VAT	1914,46
Door F R, Bump(s), Acceptable	0,00
<i>No pictures to display</i>	
Front bumper, Scratch(es), LI - Repair and paint (complete)	158,85



Roof, Chemical polution, LI - Repair and paint (complete)	361,13
---	--------



Trunk door R L, Bump(s), PDR - Knock out without painting 63,00



Wing R R, Scratch(es), LI - Repair and paint (complete) 231,15



Wheel cover R R, Missing, E - Replace 22,50



Wing F L, Bump(s), Le - Replace and paint 427,51




Bonnet, Chemical polution, LI - Repair and paint (complete) 217,56



Door moulding Lower R R, Scratch(es), E - Replace 44,00



Door F R, Scratch(es), LI - Repair and paint (complete) 238,76

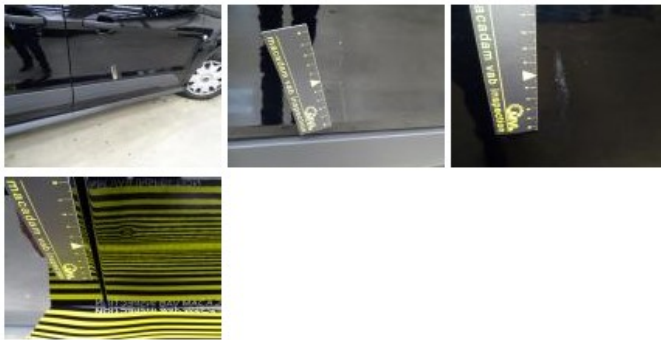

Ignition key, Missing, E - Replace 150,00

No pictures to display

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display