



KIA Carens: 1FLX254

Vinnnumber:	KNAHT815AE7023181	Versionname:	CARENS Lounge 115PK
First Registrationdate:	12/08/2013	Fiscalpower:	
Expertise Mileage:	135770	Power Kw:	85
Bodytype:		Body color	White
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:		Rims summer	Steel
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	1409
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Steel		
Category	Passenger Car		
Oil level	OK		

Options

Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/16/91 H Steel			
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Bridgestone: 6 mm	Re.R.	Bridgestone: 6 mm

Assistance equipment

Jack	Yes
Total cost ex VAT	1539,82
Wheel cover F R, Scratch(es), E - Replace	30,00



Rocker panel inner R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	115,56
--	---------------

			Trunk lid covering R, Scratch(es), Smart repair	110,64
			Door R R, Scratch(es), LI - Repair and paint (complete)	318,35
			Interior, Dirty, Cleaning	0,00
<i>No pictures to display</i>				
			Door F L, Scratch(es), LI - Repair and paint (complete)	318,35
			Bonnet, Bump(s), Acceptable	0,00
<i>No pictures to display</i>				
			Door panel F L, Tear, E - Replace	114,00
			Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)	115,56
			Tailgate, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>				
			Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete)	0,00
			Wheel cover R R, Scratch(es), E - Replace	30,00
			Wheel cover F L, Scratch(es), E - Replace	30,00



Bumper R, Scratch(es), LI - Repair and paint (complete) 211,80




Roof, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), Acceptable 0,00

No pictures to display

Wheel cover R L, Scratch(es), E - Replace 30,00

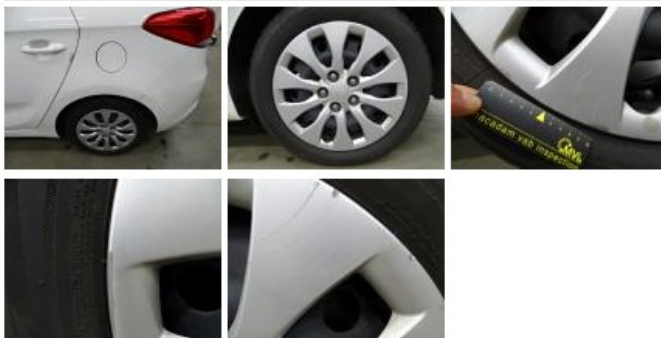

Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete) 115,56

