



RENAULT Grand Scenic: 1FE0804

Vinnumber:	VF1JZNAB649033259	Versionname:	GRAND SCENIC Bose Ed.7pl.130PK
First Registrationdate:	7/06/2013	Fiscalpower:	
Expertise Mileage:	114664	Power Kw:	96
Bodytype:	MPV	Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	3606
Number of doors:	5		
Number of seats:	7		
Number head rests:	7		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Sun Roof electric
Windows electric F	Panoramic roof
Windows electric R	Central consol F
Cruise Control	Luggage cover
Steering wheel multifunctional	Front parking sensors
Seats F heated	Rear parking sensors
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining semi-artificial leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/17/91 H LightMetal			
Winter tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm

Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT	1854,13
Front bumper, Scratch(es), LI - Repair and paint (complete)	211,80



Roof, Bump(s), LI - Repair and paint (complete)	481,50
---	--------





Door R R, Bump(s), Acceptable 0,00

No pictures to display

Door panel trim R L, Missing, E - Replace 44,00




Bonnet, Scratch(es), Acceptable 0,00

No pictures to display

Door F L, Scratch(es), LI - Repair and paint (complete) 318,35



Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80

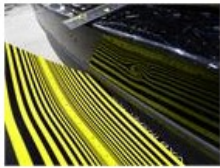

Door R L, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), LI - Repair and paint (complete) 301,68



Alloy rim F L polished, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R polished, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R polished, Scratch(es), LI - Repair and paint (complete) 95,00

