


RENAULT Grand Scenic: 1FVD921

Vinnnumber:	VF1JZ14M649764324	Versionname:	GRAND SCENIC Energy
First Registrationdate:	5/11/2013	Fiscalpower:	Intens 5pl.110PK
Expertise Mileage:	89949	Power Kw:	81
Bodytype:		Body color:	Beige
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	CARNET VIDE A CONTROLER	Parking lot:	4509
Maintenance:	OK		
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		
Registration Certificate Car (BE):	Yes		

Options

Radio CD		Central consol F
GPS storage	SD	Luggage cover
GPS storage		Rear parking sensors
Windows electric F		
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Radio multimedia		
Type of headlighting:	Headlighting Halogen	
Type of GPS:	GPS big screen color	
Type of Lining:	Lining leather	
Type of climate control:	Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/17/95 H LightMetal			
Winter tyres:	Fr.L.	Michelin: 6 mm	Fr.R.	Michelin: 6 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	1219,91
-------------------	---------

Alloy rim F L, Scratch(es), LI - Repair and paint (complete)	95,00
--	-------





Bumper spoiler F, Scratch(es), Acceptable 0,00



Headlight R, Scratch(es), Acceptable 0,00

No pictures to display

Rocker panel inner R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 115,56



Door R L, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35




Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete) 211,80



Door R R, Bump(s), PDR - Knock out without painting 63,00



Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00

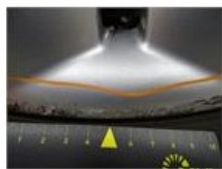




Door F R, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display

Seat cover R R, Deformed, Acceptable 0,00

No pictures to display

Outer door handle F R, Scratch(es), Acceptable 0,00

<i>No pictures to display</i>		
Door R L, Bump(s) and scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Bumper moulding F L, Scratch(es), E - Replace		14,40
		
Wing R R, Bump(s), Acceptable		0,00
<i>No pictures to display</i>		
Rearview mirror housing R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		
Alloy rim F R, Scratch(es), LI - Repair and paint (complete)		95,00
		
Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete)		211,80
		
Alloy rim R R, Scratch(es), Acceptable		0,00
<i>No pictures to display</i>		