


RENAULT Grand Espace: 1EYR164

Vinnnumber:	VF1JKFJC648703297	Versionname:	GR.ESPACE Initiale 149PK
First Registrationdate:	23/04/2013	Fiscalpower:	
Expertise Mileage:	157725	Power Kw:	110
Bodytype:	MPV	Body color:	Dark Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	NOT OK	Parking lot:	2806
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	6		
Number head rests:	6		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD		Seats electric F L	
GPS storage		Seats electric F R	
GPS storage	SD	Sun Roof electric	
Windows electric F		Panoramic roof	
Windows electric R		Central consol F	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Seats F heated		Rear parking sensors	
Type of headlighting	Headlighting Halogen	Type of Tow bar	Tow bar removable
Type of GPS	GPS big screen color		
Type of Lining	Lining leather		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	225/55/17/101 W LightMetal			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 7 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	1553,56
-------------------	----------------

Wing R R, Scratch(es), Acceptable	0,00
-----------------------------------	-------------

No pictures to display

Wing R L, Bump(s) and scratch(es), LI - Repair and paint (complete)	369,84
---	---------------



Maintenance, Maintenance, Execute	0,00
-----------------------------------	-------------

No pictures to display

Door F R, Scratch(es), LI - Repair and paint (complete)	382,02
---	---------------



Door R R, Scratch(es), LI - Repair and paint (complete) 382,02



Bonnet, Bump(s), PDR - Knock out without painting 63,00



Bumper R, Scratch(es), It - Spot repair 115,56



Front bumper, Scratch(es), Acceptable 0,00

No pictures to display

Sill outer R, Bump(s), It - Spot repair 115,56




Windscreen, Stone chip(s), Acceptable 0,00

No pictures to display

Bumper trim R, Deformed, Acceptable 0,00

No pictures to display

Backrest cover R R, Missing, E - Replace 10,00

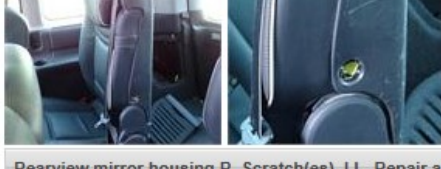

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete) 115,56

