



RENAULT Grand Scenic: 1GTA526

Vinnnumber:	VF1JZ14M650401640	Versionname:	GRAND SCENIC Energy Intens 5pl.110PK
First Registrationdate:	22/04/2014	Fiscalpower:	
Expertise Mileage:	120824	Power Kw:	81
Bodytype:		Body color	Gold
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	OK	Parking lot	2130
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		
Registration Certificate Car (BE)	Yes		

Options

Radio CD		Sun Roof electric	
GPS storage		Panoramic roof	
GPS storage	SD	Central consol F	
Windows electric F		Luggage cover	
Windows electric R		Front parking sensors	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Type of Tow bar	Tow bar fixed
Type of headlighting	Headlighting Xenon		
Type of GPS	GPS big screen color		
Type of Lining	Lining leather and alcantara		
Type of climate control	Autom climate control		

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	205/55/17/91 H LightMetal			
Winter tyres:	Fr.L.	Pirelli: 5 mm	Fr.R.	Pirelli: 5 mm
	Re.L.	Pirelli: 5 mm	Re.R.	Pirelli: 5 mm

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	------------	------	------------

Total cost ex VAT	1563,21
-------------------	----------------

Rearview mirror housing R, Scratch(es), LI - Repair and paint (complete)	115,56
--	---------------



Tailgate, Bump(s) and scratch(es), LI - Repair and paint (complete)	301,68
---	---------------



Front bumper, Scratch(es), LI - Repair and paint (complete) 211,80



Glove box cover, Scratch(es), Smart repair 110,64



Bumper R, Scratch(es), Acceptable 0,00

No pictures to display
Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Seat cover F L, Worn, Acceptable 0,00



Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35




Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Wing R L, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display
Alloy rim F R, Scratch(es), LI - Repair and paint (complete) 95,00

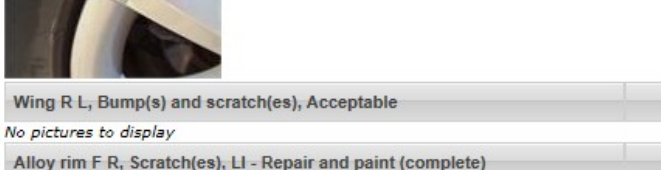

Door F L, Scratch(es), Acceptable 0,00

No pictures to display

Door R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door frame R L, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Door F R, Scratch(es), Acceptable	0,00
<i>No pictures to display</i>	
Wing F R, Scratch(es), LI - Repair and paint (complete)	220,18

