



<b>RENAULT Clio: 1EYJ510</b>			
Vinnumber:	<b>VF15R040H48670246</b>	Versionname:	<b>CLIO IV BER Expression</b>
First Registrationdate:	<b>22/04/2013</b>	Fiscalpower:	<b>75PK</b>
Expertise Mileage:	<b>78949</b>	Power Kw:	<b>55</b>
Bodytype:	<b>Hatchback</b>	Body color:	<b>Light Grey</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Metalic</b>
Transmission:		Rims summer:	<b>Steel</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>2309</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>4</b>		
Rims summer:	<b>Steel</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		

<b>Options</b>	
Windows electric F	Luggage cover
Cruise Control	
Steering wheel multifunctional	
Radio multimedia	
Type of headlighting	<b>Headlighting Halogen</b>
Type of Lining	<b>Lining fabrics</b>
Type of climate control	<b>Manual climate control</b>

<b>Limited Technical Inspection</b>			
Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>NOT OK</b>

<b>Degree of wear</b>				
Winter tyres:	<b>185/65/15/92 T Steel</b>			
	Fr.L.	<b>Continental: 4 mm</b>	Fr.R.	<b>Continental: 4 mm</b>
	Re.L.	<b>Continental: 7 mm</b>	Re.R.	<b>Continental: 7 mm</b>

<b>Assistance equipment</b>	
Jack	<b>Yes</b>
<b>Total cost ex VAT</b>	<b>1333,62</b>
<b>Seat cover F R, Hole, Smart repair</b>	<b>64,32</b>



<b>Wiper Blade L, Damaged, E - Replace</b>	<b>28,00</b>
--	--------------



<b>Wheel cover R L, Damaged, E - Replace</b>	<b>24,00</b>
--	--------------



GPS, Not functioning (well), P - Check 0,00




Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 246,56



Wheel cover F R, Damaged, E - Replace 24,00



Luggage space cover, Damaged, E - Replace 20,00

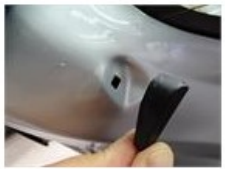

Bumper R, Scratch(es), LI - Repair and paint (complete) 169,44




Wing R L, Scratch(es), LI - Repair and paint (complete) 246,56



Bonnet, Bump(s) and scratch(es), LI - Repair and paint (complete) 232,06



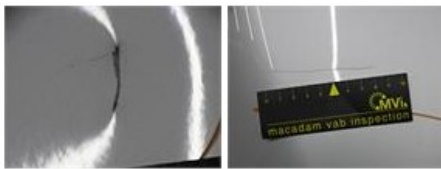

Wheel cover R R, Damaged, E - Replace 24,00



Wheel cover F L, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 254,68

