



TOYOTA Verso S: 1EXW903

Vinnnumber:	JTDKJ3C3101035878	Versionname:	VERSO S Style Multidrive S
First Registrationdate:	17/04/2013	Fiscalpower:	99PK Aut.
Expertise Mileage:	62016	Power Kw:	73
Bodytype:		Body color	Grey
Gearbox:	Automatic	Paint type	Metalic
Transmission:		Rims summer	Aluminium
Fueltype:	Petrol	Oil level	OK
Battery functioning	Yes	Parking lot	4807
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options

Radio CD	Panoramic roof
Windows electric F	Central consol F
Windows electric R	Luggage cover
Cruise Control	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	NOT OK

Degree of wear

	195/55/16/87 T LightMetal			
Winter tyres:	Fr.L.	Michelin: 7 mm	Fr.R.	Michelin: 7 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment

Total cost ex VAT	1247,58
Bumper R, Scratch(es), LI - Repair and paint (complete)	211,80





Wiper Blade L, Damaged, E - Replace 35,00



Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Bumper F R, Scratch(es), Acceptable 0,00

No pictures to display

Door R R, Scratch(es), LI - Repair and paint (complete) 318,35




Protection plate M, Tear, E - Replace 74,00



Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 318,35

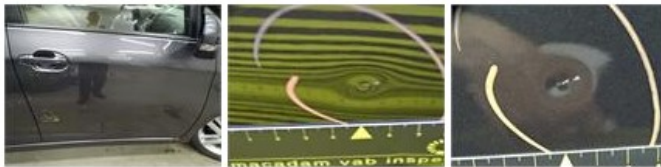

Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Chemical pollution, LI - Repair and paint (complete) 290,08

