


**SKODA Superb: 1GUL221**

Vinnumber:	<b>TMBJJ73T0E9053610</b>	Versionname:	<b>SUPERB COMBI Elegance</b>
First Registrationdate:	<b>5/05/2014</b>	Fiscalpower:	<b>DSG 105PK Aut.</b>
Expertise Mileage:	<b>143396</b>	Power Kw:	<b>77</b>
Bodytype:	<b>Break</b>	Body color:	<b>Black</b>
Gearbox:	<b>Automatic</b>	Paint type:	<b>Metalic</b>
Transmission:	<b>Front</b>	Rims summer:	<b>Aluminium</b>
Fueltype:	<b>Diesel</b>	Oil level:	<b>OK</b>
Battery functioning:	<b>Yes</b>	Parking lot:	<b>4106</b>
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Rims summer:	<b>Aluminium</b>		
Category:	<b>Passenger Car</b>		
Oil level:	<b>OK</b>		
Registration Certificate Car (BE):	<b>Yes</b>		

**Options**

Radio CD		Seats R heated	
GPS storage		Seats electric F L	
GPS storage	<b>HD</b>	Seats electric F R	
Windows electric F		Sun Roof electric	
Windows electric R		Central consol F	
Cruise Control		Luggage cover	
Steering wheel multifunctional		Front parking sensors	
Seats F heated		Rear parking sensors	
Radio multimedia		Type of Tow bar	<b>Tow bar removable</b>
Type of headlighting	<b>Headlighting Xenon</b>		
Type of GPS	<b>GPS big screen color</b>		
Type of Lining	<b>Lining leather</b>		
Type of climate control	<b>Autom climate control</b>		

**Limited Technical Inspection**

Airco functioning	<b>OK</b>	Battery functioning	<b>Yes</b>
Tires wear profile	<b>OK</b>	Power steering	<b>Yes</b>
Idle position	<b>OK</b>	Sound engine	<b>OK</b>
Engine startingtime	<b>OK</b>	Clutch test	<b>OK</b>
Exhaust gass	<b>OK</b>	Wiper fluid level	<b>OK</b>
Handbrake	<b>OK</b>	Transmission	<b>OK</b>
		Lighting	<b>OK</b>
		Wiperblades	<b>OK</b>

**Degree of wear**

	<b>225/45/17/91 W LightMetal</b>			
Summer tyres:	Fr.L.	<b>Michelin: 6 mm</b>	Fr.R.	<b>Michelin: 6 mm</b>
	Re.L.	<b>Michelin: 4 mm</b>	Re.R.	<b>Michelin: 4 mm</b>

**Assistance equipment**

Spare wheel	<b>Yes</b>	Jack	<b>Yes</b>
-------------	------------	------	------------

Total cost ex VAT	640,20
-------------------	--------


Ceiling, Stain, Cleaning	25,00
--------------------------	-------



Alloy rim R R, Scratch(es), Acceptable	0,00
----------------------------------------	------

*No pictures to display*

Floor covering F L, Damaged, E - Replace	264,00
------------------------------------------	--------

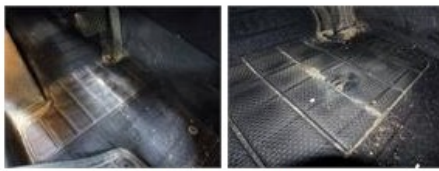

Bumper R, Scratch(es), Acceptable 0,00

No pictures to display

Bonnet, Bump(s) and scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Rocker panel inner R R, Scratch(es), Acceptable 0,00

No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Front bumper, Scratch(es), Acceptable 0,00

No pictures to display

Keys removable towhook, Missing, E - Replace 30,00



Alloy rim F R, Scratch(es), Acceptable 0,00

No pictures to display

Rearview mirror housing L, Scratch(es), LI - Repair and paint (complete) 115,56



Wing F R, Scratch(es), Acceptable 0,00

No pictures to display

Trunk lid covering R, Damaged, Smart repair 110,64

