



AUDI A6: 1FHX785

Vinnnumber:	WAUZZZ4G4EN013785	Versionname:	A6 AVANT Multitr.136PK Aut.
First Registrationdate:	3/07/2013	Fiscalpower:	
Expertise Mileage:	115500	Power Kw:	100
Bodytype:		Body color:	Dark Grey
Gearbox:	Automatic	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	4507
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Sun Roof electric
GPS storage	Panoramic roof
GPS storage SD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Front parking sensors
Cruise Control	Rear parking sensors
Steering wheel multifunctional	
Seats F heated	
Radio multimedia	
Type of headlighting Headlighting Halogen	
Type of GPS GPS big screen color	
Type of Lining Lining leather	
Type of climate control Autom climate control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

225/55/17/97 Y LightMetal				
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Continental: 0 mm	Re.R.	Continental: 5 mm

Assistance equipment


Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2114,87
-------------------	----------------

Seat cover R L, Deformed, Acceptable	0,00
--------------------------------------	-------------



Bonnet, Scratch(es), LI - Repair and paint (complete)	348,09
---	---------------

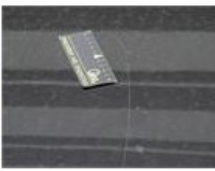

Interior, Stain, Cleaning 25,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete) 95,00



Wing F L, Scratch(es), LI - Repair and paint (complete) 264,21



Door F R, Scratch(es), Acceptable 0,00

No pictures to display

Seat cover F L, Worn, Acceptable 0,00



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F R, Scratch(es), LI - Repair and paint (complete) 264,21



Alloy rim R L, Damaged, E - Replace 277,44



Alloy rim R R, Scratch(es), LI - Repair and paint (complete) 95,00



Ignition key, Missing, E - Replace 150,00

No pictures to display

Alloy rim F R, Damaged, E - Replace

277,44




Floor covering F L, Hole, Smart repair

64,32



Seat cover F L, Deformed, Acceptable

0,00

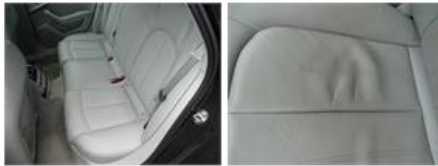

Front bumper, Bump(s) and scratch(es), LI - Repair and paint (complete)

254,16

