



FORD C-MAX: 1FBE134			
Vinnnumber:	WFOJXXWPBJCS55425	Versionname:	C-MAX Trend St/St 95PK
First Registrationdate:	14/05/2013	Fiscalpower:	
Expertise Mileage:	163639	Power Kw:	70
Bodytype:		Body color	Black
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Maintenance	OK	Parking lot	4410
Battery functioning	Yes		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options	
Radio CD	Luggage cover
GPS storage	SD
GPS storage	
Windows electric F	
Windows electric R	
Steering wheel multifunctional	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining fabrics
Type of climate control	Manual climate control

Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
Summer tyres:	215/55/16/93 H LightMetal			
	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm

Assistance equipment			
Emergency spare wheel	Yes	Jack	Yes
Total cost ex VAT			2081,69
Bumper R, Bump(s) and scratch(es), LI - Repair and paint (complete)			259,80



Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete)			318,35
---	--	--	--------



Alloy rim R R, Scratch(es), Acceptable	0,00
--	------

No pictures to display

Rear spoiler, Scratch(es), LI - Repair and paint (complete)	115,56
---	--------



Front bumper, Scratch(es), Acceptable	0,00
---------------------------------------	------

No pictures to display

Ignition key, Not functioning (well), P - Check	0,00
---	------



Door R R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display


Roof, Scratch(es), LI - Repair and paint (complete)	481,50
---	--------



Wing R R, Scratch(es), LI - Repair and paint (complete)	308,20
---	--------



Bonnet, Scratch(es), LI - Repair and paint (complete)	290,08
---	--------

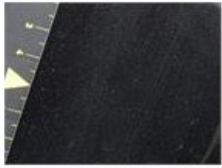

Wing R L, Rust, LI - Repair and paint (complete)	308,20
--	--------

