



FORD S Max: 1BUV839

Vinnnumber:	WF0SXXGBWSBY45320	Versionname:	S-MAX Econetic Titanium St&St DPF 115PK
First Registrationdate:	8/09/2011	Fiscalpower:	
Expertise Mileage:	145520	Power Kw:	85
Bodytype:	MPV	Body color:	Dark Brown
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Battery functioning:	Yes	Parking lot:	2323
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Seats electric F L
Windows electric F	Seats electric F R
Windows electric R	Central consol F
Cruise Control	Luggage cover
Steering wheel multifunctional	Front parking sensors
Seats F heated	Rear parking sensors
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

	225/50/17/98 W LightMetal			
Summer tyres:	Fr.L.	Goodyear: 4 mm	Fr.R.	Goodyear: 4 mm
	Re.L.	Goodyear: 5 mm	Re.R.	Goodyear: 5 mm

Assistance equipment

Repair kit	Yes	Compressor	Yes
------------	------------	------------	------------

Total cost ex VAT	2636,72
-------------------	---------



Bumper corner R L, Scratch(es), It - Spot repair	115,56
--	--------



Bumper grille, Damaged, E - Replace	64,00
-------------------------------------	-------



Door F R, Bump(s) and scratch(es), LI - Repair and paint (complete) 382,02

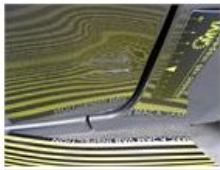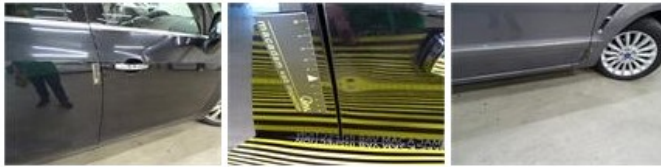

Door R R, Bump(s), Acceptable 0,00

No pictures to display

Wing R L, Scratch(es), LI - Repair and paint (complete) 369,84



Wing F L, Scratch(es), Acceptable 0,00

No pictures to display

Bumper R, Scratch(es), Smart repair 110,64



Front bumper, Scratch(es), Le - Replace and paint 862,80



Tailgate, Scratch(es), LI - Repair and paint (complete) 362,02



Wing R R, Bump(s), LI - Repair and paint (complete) 369,84

