



AUDI A3: 1FAS532			
Vinnnumber:	WAUZZZ8V8DA073485	Versionname:	A3 SB Ambition 105PK
First Registrationdate:	8/05/2013	Fiscalpower:	
Expertise Mileage:	170608	Power Kw:	77
Bodytype:	Hatchback	Body color	Dark Blue
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Rims summer	Aluminium
Fueltype:	Diesel	Oil level	OK
Battery functioning	Yes	Parking lot	3202
Number of doors	5		
Number of seats	5		
Number head rests	5		
Rims summer	Aluminium		
Category	Passenger Car		
Oil level	OK		

Options	
Radio CD	Central consol F
Windows electric F	Luggage cover
Windows electric R	Rear parking sensors
Cruise Control	
Steering wheel multifunction	
Seats F heated	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control


Limited Technical Inspection			
Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear				
	225/45/17/91 Y LightMetal			
Summer tyres:	Fr.L.	Firestone: 3 mm	Fr.R.	Firestone: 3 mm
	Re.L.	Firestone: 5 mm	Re.R.	Firestone: 5 mm


Assistance equipment			
Repair kit	Yes	Compressor	Yes
Total cost ex VAT			721,55
Door R R, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Alloy rim R L, Scratch(es), LI - Repair and paint (complete)			95,00



Wing F L, Bump(s) and scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Alloy rim F R, Scratch(es), Acceptable			0,00
<i>No pictures to display</i>			
Door F L, Bump(s), LI - Repair and paint (complete)			318,35

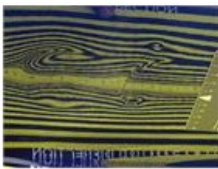

Rear window, Scratch(es), E - Replace	0,00
---------------------------------------	------

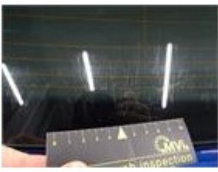

Wing R L, Scratch(es), LI - Repair and paint (complete)	308,20
---	--------



Front bumper, Scratch(es), Acceptable	0,00
---------------------------------------	------

No pictures to display

Door F R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display

Roof, Bump(s), Acceptable	0,00
---------------------------	------

No pictures to display

Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------

No pictures to display