



AUDI A4: 1EQW086

Vinnnumber:	WAUZZZ8K9DA202727	Versionname:	A4 AVANT TDie 136PK
First Registrationdate:	26/02/2013	Fiscalpower:	
Expertise Mileage:	187993	Power Kw:	100
Bodytype:		Body color:	Black
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Rims summer:	Aluminium
Fueltype:	Diesel	Oil level:	OK
Maintenance:	OK	Parking lot:	3223
Battery functioning:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Rims summer:	Aluminium		
Category:	Passenger Car		
Oil level:	OK		

Options

Radio CD	Central consol F
GPS storage	Luggage cover
GPS storage	HD Rear parking sensors
Steering wheel multifunction	
Seats F heated	
Radio multimedia	
Type of headlighting	Headlighting Halogen
Type of GPS	GPS big screen color
Type of Lining	Lining leather
Type of climate control	Autom climate control
Adaptive cruise control	

Limited Technical Inspection

Airco functioning	OK	Battery functioning	Yes
Tires wear profile	OK	Power steering	Yes
Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Wiper fluid level	OK
Handbrake	OK	Transmission	OK
		Lighting	OK
		Wiperblades	OK

Degree of wear

205/60/16/92 H LightMetal				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm


Assistance equipment

Emergency spare wheel	Yes	Jack	Yes
-----------------------	------------	------	------------

Total cost ex VAT **1676,96**

Bumper R, Bump(s) and scratch(es), E - Replace **415,20**



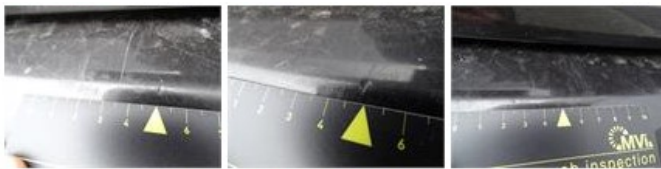

Wing R R, Bump(s) and scratch(es), LI - Repair and paint (complete) 308,20



Ignition key, Not functioning (well), Repair/replace (lump sum) 0,00

No pictures to display

Tailgate, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim F R, Damaged, E - Replace 235,20



Ceiling, Stain, Cleaning 25,00



Wing R R, Scratch(es), Acceptable 0,00

No pictures to display

Alloy rim R L, Scratch(es), LI - Repair and paint (complete) 95,00



Alloy rim R R, Scratch(es), Acceptable 0,00

No pictures to display

Wing F L, Scratch(es), LI - Repair and paint (complete) 315,18



Door R R, Bump(s), PDR - Knock out without painting 63,00



Alloy rim F L, Scratch(es), LI - Repair and paint (complete)

220,18

